

May 10, 2018

Mr. Michael Terpinski  
Ohio EPA, NWDO, DERR  
347 North Dunbridge Road  
Bowling Green, OH 43402

**Re: EnviroSAFE Services of Ohio, Inc.  
EPA Identification Number: OHD 045 243 706  
April 2018 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), EnviroSAFE Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning April 1, 2018 and ending April 30, 2018.

**Corrective Measures Implementation ("CMI"):**

**Project Activities:**

During this reporting period, CMI activities included the following:

1. On April 27, 2018 in accordance with the compliance plan of action, ESOI completed monthly elevation monitoring at the following wells which exceeded their respective TLLs in the prior month.

**SWMU 5 Central: 557.1**

- PZ-5: 570.01
- PZ-6: 560.65
- PZ-7: 559.96
- PZ-21: 561.72

**SWMU 6: 566.9**

- DPW-16: (well not usable - nearby replacement NRP-32 is operating)
- NRP-25: 576.31
- NPR-26: 579.76

**SWMU 7: 570.8**

- PZ-10: (well not usable - nearby wells are operating)
- PZ-11: 572.75
- DPW-20: (well not usable - nearby wells are operating)

2. Leachate system maintenance included:

- Inspection of piezometers and recovery wells on SWMU 5, 6, and 7;
  - Recorded liquid level at each location with a control panel;

- Verified functionality of all pumps without a control panel;
    - Evaluated control panels where water spray was observed and seals are tight;
  - DPW-19
    - Panel buttons not working;
  - NRP-25
    - Observed to have little discharge. May need to redevelop as weather permits;
  - NRP-26
    - Observed below the low point and not pumping. Pulled pump and transducer and cleaned. Pump began cycling as designed. Will need to be redeveloped.
  - NRP-34
    - Transducer replaced and pump cleaned;
  - SWMU 6 Compressor Shed:
    - Manually drained compressor and emptied moisture buckets;
    - Additional screws in metal roof may be needed due to wind;
  - SWMU 5 Compressor
    - Auto drain working and adjusted;
    - Condensation discharged from controller;
3. Sampled NRP-25, 26, 28, 29, 33, PZ-15, and DPW-18 for Appendix 98 constituents; and
4. Continued operation and monitoring of the leachate extraction systems on SWMUs 5, 6, and 7.

**Summary of All CMI-Related Contacts with the Public:**

ESOI has not had any related contacts with the public during this reporting period.

**Summary of Potential or Encountered Problems and Rectification Actions:**

There is nothing to report in association with this topic for this reporting period.

**Projected Work:**

During the next reporting period it is anticipated that the following activities will occur:

1. Repair/Replace DRP-19 control panel display on 5/8/2018
2. Schedule replacement of DPW-21;
3. Sample additional SWMU leachate relative to adjacent monitoring wells;
4. Continued redevelopment of leachate extraction wells in accordance with priority list, with the siltiest wells being addressed first as time and weather allows;
  - a. Priority redevelop of RW-1, NRP-26, NRP-25, NRP-24, DPW-22, DPW-23, and RW-11; and
5. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

Mr. Michael Terpinski

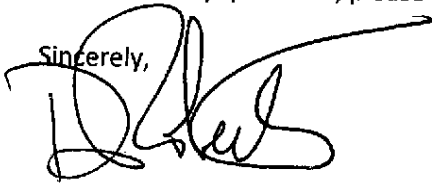
May 10, 2018

Page 3

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Stephen DeLussa at (215) 659-2001 ext. 15.

Sincerely,

A handwritten signature in black ink, appearing to read 'D. Roberts', with a long horizontal stroke extending to the right.

Douglas E. Roberts  
President

cc: Stephen DeLussa, Envirosource Technologies, Inc.  
Mark Nielsen, Ramboll

Michael Momenee, The Mannik & Smith Group