

September 11, 2019

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: Envirosafe Services of Ohio, Inc.
 EPA Identification Number: OHD 045 243 706
 August 2019 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning August 1, 2019 and ending August 31, 2019.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. Analytical results were received on August 7, 2019 for liquid from SWMU 9. It will be used in the disposal profile approval process;
2. Ohio EPA shared revised draft permit language on August 12, 2019 for the implementation of the approved final design plans and ESOI provided comment on August 13, 2019;
3. A meeting was held with Geo. Gradel Co. on August 22, 2019 to discuss procurement of materials and installation of the sheet pile wall around SMWU 8;
4. Ohio EPA approved the CMI Final Design Permit Modification on August 29, 2019;
5. The replacement building materials for SWMU 8 were delivered;
6. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMUs 5 and 6:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - SWMU-7 pumps were shut off due to storage tank sensor malfunction;

- RW-1: Pulled pump, cleaned pump and transducer, repaired leak at airline connection, replaced secondary pump screen, and, added ~1 gallon of Simple Green;
- NRP-26: Transducer was pulled and cleaned, subsequently the well was redeveloped and then the transducer was pulled and cleaned again;
- NRP-32: Pulled Pump, cleaned pump, drained water from airline and tightened fittings, and, returned pump to desired level;
- Exercised grundfos pumps that have not been running since adjustments to pump inlets have been made.
 - Added ~0.5 gallon of Simple Green and temporarily lowered interval to activate pump.
 - Reset interval after a few minutes of pumping.
 - DPW-23 pump works; however, transducer reading does not change and both pump and transducer are stuck in well;
- SWMU 7 Tank: Investigating why level sensors occasionally indicate full tanks when tanks are not full.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:

1. Submit abandonment report for closed inactive RFI wells;
2. Construction for replacement of AOC 3 (Building C);
3. Removal of leachate from SWMU 8;
4. Evaluate, clean, and / or repair high priority wells as appropriate;
5. Continue to seed any areas of bare soil;
6. Repair SWMU 7 storage tank level sensor;
7. Conduct CMI start-up meeting and request a proposal for field work;
8. Continued redevelopment of leachate extraction wells in accordance with priority list, with the siltiest wells being addressed first as time and weather allows; and

Mr. Michael Terpinski

September 11, 2019

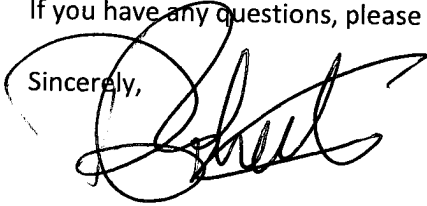
Page 3

9. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Stephen DeLussa at (215) 659-2001 ext. 15.

Sincerely,

A handwritten signature in black ink, appearing to read "Douglas E. Roberts", written over the word "Sincerely,".

Douglas E. Roberts
President

cc: Stephen DeLussa, Envirosource Technologies, Inc.
Mark Nielsen, Ramboll

Michael Momenee, The Mannik & Smith Group