



876 Otter Creek Road
Oregon, Ohio 43616-3518
Phone: (419) 698-3500
Fax (419) 698-8663
Website: www.envirosafeservices.com

April 12, 2019

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: EnviroSAFE Services of Ohio, Inc.
EPA Identification Number: OHD 045 243 706
March 2019 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), EnviroSAFE Services of Ohio, Inc. ("ESO") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning March 1, 2019 and ending March 31, 2019.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. All leachate extraction system pumps and compressors on SWMUs 5, 6, and 7 were restarted on March 29, 2019 following being shut down for a period to protect the system from damage due to freezing conditions and inaccessibility for maintenance due to snow and ice;
2. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMU 5, 6, and 7;
 - All transducers removed and cleaned prior to startup with the exception of DPW-23 (The well casing is warped and the transducer is attached to the pump);
 - All transducers on/off levels were adjusted to balance risks of drawdown and leachate removal versus inflow of alternate source contaminants;
 - Raised pump inlets without a control panel;
 - PZ-15: Air discharge lines appeared severed and require replacement;
 - DPW-18: Fitting connections were tightened to stop minor leak;
 - NRP-28: Transducer was observed to be damaged and requires replacement;
 - NRP-30: Observed not pumping when control panel was turned on, possible bad starter;
3. Submission of the Annual Report on March 1, 2019; and
4. Preparation of final remedy designs.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:


During the next reporting period it is anticipated that the following activities will occur; some pending the resumption of pumping activities after temperatures rise above 32 degrees Fahrenheit:

1. Submission of final remedy designs;
2. Replace transducers as needed;
3. Switch out NRP-30 starter and evaluate further;
4. Collect leachate levels, evaluate active pump low point settings, and adjust accordingly;
5. Repair any pumps needing repair due to winter conditions shutdown;
6. Continued redevelopment of leachate extraction wells in accordance with priority list, with the siltiest wells being addressed first as time and weather allows; and
7. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Stephen DeLussa at (215) 659-2001 ext. 15.

Sincerely,

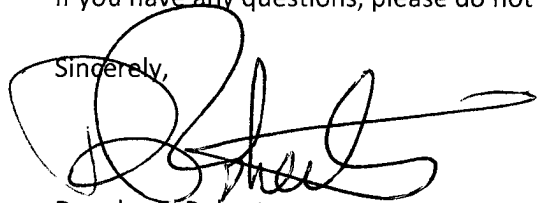

Douglas E. Roberts
President

ec: Stephen DeLussa, Envirosource Technologies, Inc.
Mark Nielsen, Ramboll

Michael Momenee, The Mannik & Smith Group