



876 Otter Creek Road
Oregon, Ohio 43616-3518
Phone: (419) 698-3500
Fax (419) 698-8663
Website: www.envirosafeservices.com

December 11, 2018

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: EnviroSafe Services of Ohio, Inc.
EPA Identification Number: OHD 045 243 706
November 2018 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), EnviroSafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning November 1, 2018 and ending November 30, 2018.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. Verified flow at each recovery well where leachate is present on November 2, 9, 16, 21, and 30, 2018;
2. Submission of agreed upon revisions to the Corrective Action Permit Modification Request 014 on November 1, 2018;
3. Preliminary engineering for SWMU 8;
4. Preparation of a Corrective Measures Completion of Work (CMCW) Report in accordance with Permit Condition E.12. On June 20, 2018, Ohio EPA finalized a Director Initiated Modification (DIM) to ESOI's RCRA Permit. The modification incorporated specific corrective measures including some of the previously completed storm water management improvements – specifically, those required by Permit Condition E.9(c)(v)(a) and as subset of those required by E.9(c)(xi) located between Cells H and I;
5. Submission of the annual inflationary and cost estimate updates for Corrective Action on November 9, 2018;
6. Preparation of a well abandonment plan for inactive wells;
7. Preparation and submittal of discharge requirements for SWMU water disposal;

8. Leachate system maintenance included:

- Inspection of piezometers and recovery wells on SWMU 5, 6, and 7;
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - Exercised all globe valves on active pumps;
- RW-1
 - Pump was pulled, cleaned and reinstalled;
 - Solenoid 2's on/off switch was toggled between on/off positions
 - Switched RW-1 to a single air outlet;
- PZ-13
 - Pump was pulled to evaluate the airline for condensation buildup (none observed);
- PZ-15
 - Switched airline ports and pump resumed operation;
- NRP-25
 - Observed to be pumping at approximately 0.5 gallons per minute;
- NRP-28
 - Insulation was repaired;
- SWMU 6 Compressor
 - Emptied moisture buckets; and

9. Continued operation and monitoring of the leachate extraction systems on SWMUs 5, 6, and 7.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:

During the next reporting period it is anticipated that the following activities will occur:


1. Submission of a CMCW Report for storm water management improvements around SWMUs 5, 6, and 7;
2. Adjust transducer on/off levels to balance risks of drawdown and leachate removal versus inflow of alternate source contaminants;
3. Insulate extraction wells as appropriate;
4. Continued evaluation of alternative pumps for leachate collection;

5. Continued redevelopment of leachate extraction wells in accordance with priority list, with the siltiest wells being addressed first as time and weather allows; and
6. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Stephen DeLussa at (215) 659-2001 ext. 15.

Sincerely,

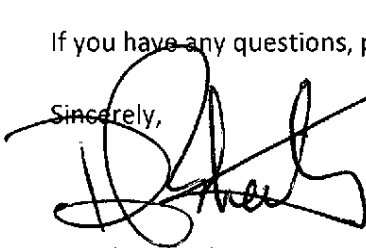

Douglas E. Roberts
President

cc: Stephen DeLussa, Envirosource Technologies, Inc.
Mark Nielsen, Ramboll

Michael Momenee, The Mannik & Smith Group