

June 7, 2022

VIA ELECTRONIC MAIL

Mr. Michael Terpinski
Ohio EPA, NWDO, DERR
347 North Dunbridge Road
Bowling Green, OH 43402

**Re: Envirosafe Services of Ohio, Inc.
 EPA Identification Number: OHD 045 243 706
 May 2022 Progress Report**

Dear Mr. Terpinski:

In accordance with Condition E.13 of its Ohio Hazardous Waste Facility Installation and Operation Permit (the "Permit"), Envirosafe Services of Ohio, Inc. ("ESOI") hereby submits this progress report to the Ohio Environmental Protection Agency ("Ohio EPA") for the period beginning May 1, 2022 and ending May 31, 2022.

Corrective Measures Implementation ("CMI"):

Project Activities:

During this reporting period, CMI activities included the following:

1. Continued coordination with Ohio EPA on the preparation of the Environmental Covenant;
2. Coordination for evaluation of the SWMU 7 roadway in the area of boring S7-202;
3. Leachate system maintenance included:
 - Inspection of piezometers and recovery wells on SWMUs 5, 6, and 7:
 - Recorded liquid level at each location with a control panel;
 - Verified functionality of all pumps without a control panel;
 - All pumps with a control panel were observed to be below their respective low points with the exception of: DPW-18, 19, NRP-24, 25, 26, 27, 29, 30, 31, 33, 34, and 35;
 - DPW-18: Repaired damaged transducer cable;
 - NRP-29: Observed above the hi point: replaced damaged surge protector in control panel and attached lightning arrestor, replaced corroded wire in control panel and cleaned actuator connections, found hole in Grundfos pump – replaced prior to this report;
 - SWMU 5 Tank Area: Ran sump pump to remove water;
 - SWMU 5 Compressor: Drained moisture from controller, repaired leaking airline; and
 - SWMU-6 General: Circuit breakers tripping, under investigation;
 - SWMU 6 Compressor: Emptied buckets, replaced regulator gauge, and replaced timer for solenoid valves prior to checking pneumatic pumps; compressor attic fan was observed to be functioning as designed; and

4. Solar Sipper – inspected and found to be operating as designed.

Summary of All CMI-Related Contacts with the Public:

ESOI has not had any related contacts with the public during this reporting period.

Summary of Potential or Encountered Problems and Rectification Actions:

There is nothing to report in association with this topic for this reporting period.

Projected Work:


During the next reporting period it is anticipated that the following activities will occur:

1. Replace Grundfos pump at NRP-29 (completed prior to this report);
2. Order additional timers for pneumatic pumps on SWMU-6 (to distribute load, and for backup);
3. Preparation and submission of a Corrective Measures Completion of Work Report for the northern property line excavation at SWMU 6 for submission in June.
4. Development of an O&M Plan for the newly installed SWMU 8 extraction wells and gas vents through June;
5. Action on the Environmental Covenant pending Ohio EPA review of the draft document;
6. Evaluation of the SWMU 7 roadway in the area of boring S7-202; and
7. Continued operation and maintenance of the leachate extraction systems on SWMUs 5, 6, and 7.

I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gather and evaluate the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

If you have any questions, please do not hesitate to contact Stephen DeLussa at (215) 659-2001 ext. 15.

Sincerely,

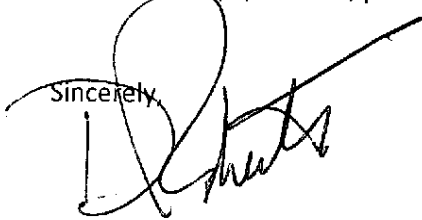

Douglas E. Roberts
President

cc: Gary Deutschman, Ohio EPA-NWDO, DERR
Stephen DeLussa, Envirosource Technologies, Inc.
Michael Momenee, The Mannik & Smith Group

Dawn Pleiman, Ohio EPA-NWDO, DERR
Mark Nielsen, Ramboll